

# DESCO INDUSTRIES INCORPORATED


3651 WALNUT AVE. CHINO, CA 91710 PHONE (909) 627-8178 FAX (909) 627-7449

## A98100 WRIST STRAP TESTER ADJUSTMENT INSTRUCTIONS

PARTS LIST:	1 EA. 675 K RESISTOR
	1 EA. 825 K RESISTOR
	1 EA. 8.5 M RESISTOR
	1 EA. 11.5 M RESISTOR

RESISTOR VALUE	ADJUSTMENT DEVICE	DESIRED INDICATION
a) 8.5 M	TRIMPOT #1	GREEN
b) 11.5 M	TRIMPOT #1	YELLOW
c) 675 K	TRIMPOT #2	RED
d) 825 K	TRIMPOT #2	GREEN

TABLE 1

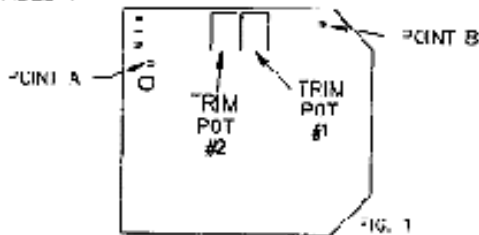

STEP #1 UNSCREW BOTTOM COVER AND CAREFULLY SET ASIDE. TURN TRIMPOTS #1 AND #2, 25 TURNS COUNTERCLOCKWISE. (SEE FIG. 1)

STEP #2 TEMPORARILY CONNECT ONE RESISTOR AT A TIME BETWEEN POINTS "A" AND "B" ADJUST PER TABLE 1 FOR DESIRED RESULT.

NOTE: THE MICRO SWITCH MUST BE DEPRESSED WHILE ADJUSTING!

STEP #3 IF THE RESULTS DO NOT MATCH CHART, REPEAT STEPS #1 AND #2. WHEN RESULTS ARE SATISFACTORY, REMOVE ADJUSTING RESISTOR AND CLOSE UNIT. UNIT MAY NOW BE RETURNED TO SERVICE.

THE ADJUSTMENT PROCEDURE JUST OUTLINED WILL YIELD THE FOLLOWING PARAMETERS:

LESS THAN 825 K = RED - "HAZARD"

825K TO 8.5 M = GREEN - "GOOD"

GREATER THAN 8.5 M = YELLOW - "HIGH RESIST"